
BURNDY<sup>®</sup> Products FS Grounding


## **TYPES GB, GBM**

## **GROUND CONNECTOR**

For Copper Cable to Bar

High copper alloy ground connector for joining a range of cable to 1/4" thick bar.\* Type GB separates cable from bar, GBM clamps cable directly on bar surface. One-wrench installation. UL467 Listed. The high copper alloy cast body and DURIUM™ bolts, nuts, and lockwashers make the GB and GBM suitable for direct burial in concrete or ground.

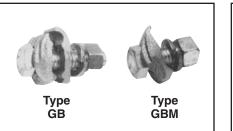

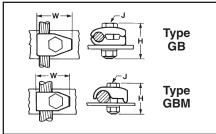

D-47



			Н	Н		W	W
Catalog Number			Туре	Туре		Туре	Туре
Type GB	Type GBM	Conductor	GB/GBL	GBM	J	GB/GBL	GBM
GB4C	GBM4C	8 Sol 4 Str.	1-1/2	1-1/2	3/8	1-1/4	1-1/4
GB26	GBM26	4 Sol 2/0 Str.		1-1/2	3/0	1-1/2	1-1/2
+GBL30		4 Sol 300	2			7/8	0
GB29	GBM29	2/0 Sol 250		2	1/2	2	2
GB34	GBM34	300 - 500	3	2-1/4		2-3/8	2-3/8

+ GBL30 is not UL listed.

Add "GS" suffix for galvanized steel hardware.


\* For other bar thicknesses see note at bottom of page D-46.


## **TYPES GC, GCM**

## **GROUND CONNECTOR**

For Two Copper Cables to Bar

High copper alloy ground connector for joining a wide range of two parallel cables to 1/4" thick bar.\* Type GC separates cable from bar, GCM clamps cable to bar surface. One-wrench installation. UL467 Listed. The high copper alloy cast body and DURIUM™ bolts, nuts, and lockwashers make the GC and GCM suitable for direct burial in concrete or ground.

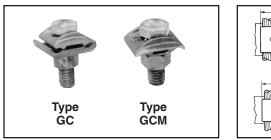

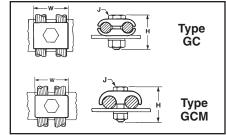



			н	н		W	W
Catalog Number			Туре	Туре		Туре	Туре
Type GC	Type GCM	Conductor	GC/GCL	GCM	J	GC/GCL	GCM
GC4C4C	GCM4C	8 Sol 4 Str.	1-1/2	1-1/2	3/8	1-3/8	1
GC2626	GCM26	4 Sol 2/0 Str.	2	1-1/2	3/8	1-3/4	1-3/8
GCL30	GCM30	4 Str 300	2	—	—	1	—
GC2929	GCM29	2/0 Sol 250	2-1/4	2	—	2-1/4	2
GC3434	GCM34	300 - 500	2-7/8	2-1/4	1/2	2-7/8	2-5/8

Smooth oval-shank bolts are available upon request for cabletray applications (example: GC30G3). Also refer to type GC-CT.

Add "GS" suffix for galavanized steel hardware.

 $^{\ast}\,$  For other bar thicknesses see note at bottom of page D-44.