


## YC-C

## COPPER CRIMPIT™

## Line Tap for Range of Copper

Range-taking compression tap connector made of pure copper. Designed to be gripped in the jaws or dies of installation tool, then slipped directly over line for easy installation. Also used for deadending.

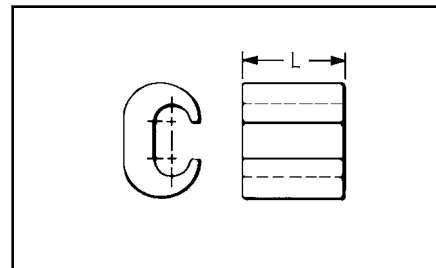

| Copperweld-Copper Conductors                      |
|---------------------------------------------------|
| 8A - Use CRIMPITS™ accommodating 6 str. Copper    |
| 6A - Use CRIMPITS™ accommodating 4 Str. Copper    |
| 4A - Use CRIMPITS™ accommodating 2 Str. Copper    |
| 2A - Use CRIMPITS™ accommodating 1/0 & 2/0 Copper |



RUS Accepted

| Catalog Number | Run                 | Tap                 | L   | Die Index | Tools, Die Set Catalog Number, & (Number of Crimps) |          |                       | CRIMPIT™ for 1 Str. Copper |                  |
|----------------|---------------------|---------------------|-----|-----------|-----------------------------------------------------|----------|-----------------------|----------------------------|------------------|
|                |                     |                     |     |           | MD7, MD6                                            | OUR840   | Y35, Y750, Y45†, Y46‡ | Run                        | Tap              |
| YC10C10*       | 12 Sol. - 10 Str.   | 12 Sol. - 10 Str.   | 3/8 | 238       | W238 (1)                                            | W238 (1) | U238 (1)              | —                          | —                |
| YC8C8          | 8 Sol. - 8 Str.     | 10 Sol. - 8 Str.    | 1/2 | 162 or K  | W 162 (2)                                           | W162 (2) | U162** (1)            |                            |                  |
| YC4C8          | 6 Sol. - 4 Str.     | 8 Sol. - 8 Str.     | 5/8 | BG or 5/8 | BG (2)<br>W-BG** (1)                                | XBG (2)  | U-BG (1)              |                            |                  |
| YC4C6          |                     | 6 Sol. - 6 Str.     |     |           |                                                     |          |                       |                            |                  |
| YC4C4          |                     | 4 Sol. - 4 Str.     |     |           |                                                     |          |                       |                            |                  |
| YC2C4          | 2 Sol. - 2 Str.     | 8 Sol. - 4 Str.     | 3/4 | C         | W-C (2)                                             | —        | U-C (1)               | 1 Str.                     | 6.8 Str., 8 Sol. |
| YC2C2          | 2 Sol. - 2 Str.     | 2 Sol. - 2 Str.     |     |           |                                                     |          |                       | —                          | —                |
| YC26C2         | 1/0 Sol. - 2/0 Str. | 8 Sol. - 2 Str.     | 7/8 | E or O    | —                                                   | —        | U-E (3)<br>U-O (1)    | 1 Str.                     | 1 or 2 Str.      |
| YC26C26        |                     | 1/0 Sol. - 2/0 Str. |     |           |                                                     |          |                       |                            |                  |
| YC28C2         |                     | 3/0 Sol. - 4/0 Str. |     |           |                                                     |          |                       | 6 Sol. - 2 Str.            | 1-1/16           |
| YC28C26        | 1/0 Sol. - 2/0 Str. |                     |     |           |                                                     |          |                       |                            |                  |
| YC28C28        | 3/0 Sol. - 4/0 Str. |                     |     |           |                                                     |          |                       |                            |                  |

\*\* Multiple crimp die set. Makes more than one crimp per tool compression. Figure ( ) indicates number of compressions.

† U Die with adapter PT-6515.

‡ U Die with adapter PUADP-1.


\* Not UL listed.

## TYPE YP-C

## COPPER CRIMPIT™

## Line Tap for Extra Wide Range of Copper

Figure "6" -shaped, wide range-taking copper, compression tap connector for primary service taps and secondary service drops. Connector can be gripped in tool and slipped over the line for easy installation.

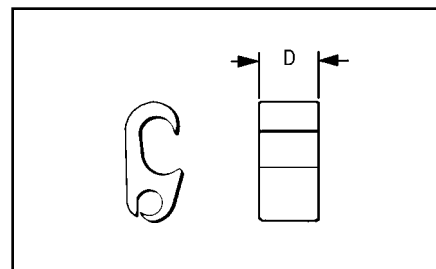

| Catalog Number | D    | Run                 | Tap                 | Die Index | Tools, Die Set Catalog No., & (Number of Crimps) Y35, Y750, Y45†, Y46‡ |
|----------------|------|---------------------|---------------------|-----------|------------------------------------------------------------------------|
| <b>YP2C2</b>   | .75  | 6 Sol. - 2 Str.     | 6 Sol. - 2 Str.     | 0         | U-0 (1)                                                                |
| <b>YP28C28</b> | 1.00 | 2/0 Str. - 4/0 Str. | 2/0 Str. - 4/0 Str. | D         | U-D3 (1)                                                               |
| <b>YP29C26</b> | .75  | 1/0 Str. - 250      | 4 Sol. - 2/0 Str.   |           |                                                                        |

† U Die with adapter PT-6515.

‡ U Die with adapter PUADP-1.

Throughout the catalog you will notice blue highlighted items. These are the most frequently ordered BURNDY® Products.