


CC-2

TYPE MOLDS

Horizontal Cable Tap to Horizontal Cable Run
For Metric Conductors

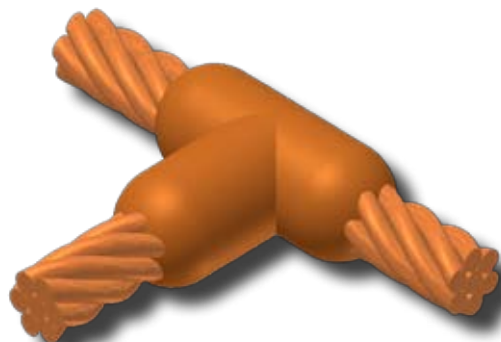

MOLDS FOR METRIC CONDUCTORS

Cable (mm ²)		Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time
Run	Tap					
10	10	M-10780	4	32	B-106	4
16	16	M-10781	4	32	B-106	2
25	25	M-3021	4	45	B-106	2
5.6 mm Ø	5.6 mm Ø	M-2914	4	45	B-106	4
30	30	M-2915	4	45	B-106	4
35	35	M-3022	4	45	B-106	2
	25	M-3023	4	45	B-106	2
8 mm Ø	8 mm Ø	M-2949	4	65	B-106	2
50	50	M-3024	4	90	B-106	2
	35	M-3025	4	65	B-106	2
	25	M-3026	4	65	B-106	2
10 mm Ø	10 mm Ø	M-2916	4	90	B-106	2
70	70	M-3031	4	90	B-106	2
	50	M-3033	4	90	B-106	2
	35	M-3034	4	65	B-106	2
	25	M-3035	4	65	B-106	2
95	95	M-3041	4	115	B-106	2
	70	M-3043	4	90	B-106	2
	50	M-3045	4	90	B-106	2
	35	M-3046	4	90	B-106	2
120	120	M-3047	4	150	B-106	2
	95	M-3048	4	150	B-106	2
	70	M-3051	4	90	B-106	2
	50	M-3052	4	90	B-106	2
150	150	M-3053	4	200	B-106	2
	120	M-3054	4	150	B-106	2
	95	M-3055	4	150	B-106	2
	70	M-3057	4	90	B-106	2
185	185	M-3059	4	200	B-106	2
	150	M-3060	4	200	B-106	2
	120	M-3061	4	200	B-106	2
	95	M-3062	4	150	B-106	2
240	240	M-3065	4	2-150	B-106	2
	185	M-3066	4	200	B-106	2
	150	M-3067	4	200	B-106	2
	120	M-3068	4	200	B-106	2
300	300	M-3071	5	2-200	B-107	2
	240	M-3072	5	2-200	B-107	2
	185	M-3073	4	250	B-106	2
	150	M-3074	4	200	B-106	2

- **For sizes not listed, contact thermOweld®.**
- For heavy duty connections or molds with wear plates, contact thermOweld®.
- For expedited service, contact thermOweld®.
- Required Tools;
 - Handle Clamps w/ Flint Ignitor (see chart for correct handles)
 - 38-0309-00 ~ Flint Ignitor
- Other recommended accessories;
 - 40-0319-01 ~ Mold Cleaner for cartridge sizes #15-#65
 - 40-0319-03 ~ Mold Cleaner for cartridge sizes #90-#500
 - 38-3922-00 ~ Mold Cleaning Brush
 - 38-0135-00 ~ Cable Cleaning Brush
 - 38-0330-00 ~ Cable Clamp