


CC-11

TYPE MOLDS

Horizontal to Horizontal Cable Cross
For AWG Conductors

MOLDS FOR AWG CONDUCTORS						
Cable		Mold #	Price Key	Weld Metal	Handle Clamps	Lead Time
Run	Tap					
#6	#6	M-6057	4	45	B-106	2
#4	#4	M-2687	4	65	B-106	2
#2	#2	M-2689	4	90	B-106	2
	#4	M-2690	4	65	B-106	4
#1	#1	M-2691	4	115	B-106	2
	#2	M-2692	4	90	B-106	4
	#4	M-2693	4	90	B-106	4
1/0	1/0	M-2694	22	150	B-106	2
	#1	M-2695	22	150	B-106	4
	#2	M-2696	22	115	B-106	2
	#4	M-2697	22	115	B-106	4
2/0	2/0	M-2698	22	200	B-106	SDS
	1/0	M-2699	22	200	B-106	4
	#1	M-2700	22	150	B-106	4
	#2	M-2701	22	150	B-106	4
3/0	3/0	M-2702	22	250	B-106	2
	2/0	M-2703	22	200	B-106	4
	1/0	M-2704	22	200	B-106	4
	#1	M-2705	22	150	B-106	4
	#2	M-2706	22	150	B-106	4
4/0	4/0	M-2707	22	250	B-106	SDS
	3/0	M-2708	22	250	B-106	2
	2/0	M-2709	22	200	B-106	2
	1/0	M-2710	22	200	B-106	2
	#1	M-2711	22	150	B-106	4
	#2	M-2712	22	150	B-106	2
250 MCM	250 MCM	M-2713	22	2-150	B-106	2
	4/0	M-2714	22	2-150	B-106	2
	3/0	M-2715	22	2-150	B-106	4
	2/0	M-2716	22	250	B-106	4
	1/0	M-2717	22	150	B-106	4
	#1	M-2718	22	200	B-106	4
500 MCM	#2	M-2719	22	150	B-106	4
	500 MCM	M-2747	23	3-250	B-107	2
	250 MCM	M-2751	23	500	B-107	4
	4/0	M-2752	23	500	B-107	2
	3/0	M-2753	23	500	B-107	4
	2/0	M-2754	23	2-200	B-107	4
	1/0	M-2755	22	2-150	B-106	4
	#1	M-2756	22	250	B-106	4
	#2	M-2757	22	250	B-106	4

- For sizes not listed, contact thermOweld®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For heavy duty connections or molds with wear plates, contact thermOweld®.
- For expedited service, contact thermOweld®.
- Required Tools;
 - Handle Clamps w/ Flint Ignitor (see chart for correct handles)
 - 38-0309-00 ~ Flint Ignitor
- Other recommended accessories;
 - 40-0319-01 ~ Mold Cleaner for cartridge sizes #15-#65
 - 40-0319-03 ~ Mold Cleaner for cartridge sizes #90-#500
 - 38-3922-00 ~ Mold Cleaning Brush
 - 38-0135-00 ~ Cable Cleaning Brush
 - 38-0330-00 ~ Cable Clamp

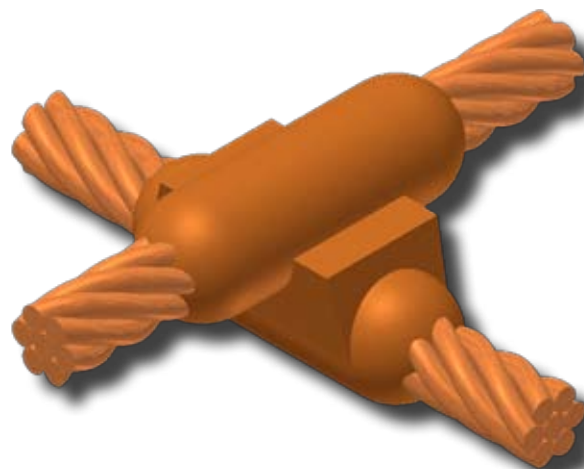

Section 2 - Molds
AWG Conductors